

Please email your written response to safety@dopl.idaho.gov. Please include your Facility/Business No on the reply.

Office: 208-334-3233
E-mail: safety@dopl.idaho.gov

FACILITY REPORT

Facility / Business No: E-091-0002 / 6623

Inspector: RUSSELL SIDELL

Inspection Date: 01/04/2021

Owner: Idaho Falls School Dist #91
690 John Adams Parkway
Idaho Falls, ID 83401

Location:
Idaho Falls Sr High School
601 S HOLMES AVE
IDAHO FALLS, ID 83401

Contact: Kevin Klingler
Contact Phone: 2085257502
Contact E-mail: klinkevi@d91.k12.id.us

A response regarding your plans for corrective action for the potential safety hazards is required within 20 calendar days of receipt of report. Corrections need not be completed to respond. Should additional time be needed to formulate responses, an extension of time for up to 60 days may be requested. Include the Business number or State ID number with your response.

Recommendations:

(1/14/2021 10:08 AM RSI)

SAFETY ALERT

EACH YEAR HUNDREDS OF OUR FELLOW EMPLOYEES WERE INJURED ON THE JOB A LARGE PERCENTAGE OF THESE INJURIES WERE DUE TO SLIP AND FALLS THIS INCLUDES SNOW AND ICE, UNEVEN WALKING SURFACES (SIDEWALKS, FLOORS, STEPS), AND HOUSEKEEPING. WE NEED TO KEEP CORDS AND MATERIALS FROM BECOMING TRIP HAZARDS. LETS ALL HELP EACH OTHER GO HOME SAFE EVERY DAY.

The city of Idaho Falls approved a temporary use of (2) modular units on the East side of school.

1. 1910.305(g)(1)(iv)(E) Flexible electric cords are not allowed to be concealed behind building walls, ceilings, or floors. several rooms are still using ceiling projectors. (Cords into ceiling grid) 8th year REPEAT.
2. 1910.36(g)(4) Objects that project into the exit route must not reduce the width of the exit route to less than the minimum width requirements for exit routes. F.C. Table 1004.1 Requires 20sq.ft. net per occupant in E-occupancy. Room is overcrowded. (excess furniture materials). There are several very small rooms. Need to monitor. REPEAT.
3. 1910.151(b) In the absence of an infirmary, clinic, or hospital in near proximity to the workplace which is used for the treatment of all injured employees, a person or persons shall be adequately trained to render first aid. Adequate first aid supplies shall be readily available. Out of date first aid supplies. Custodial closet main basement office.
4. 1910.141(a)(3)(i) All places of employment shall be kept clean to the extent that the nature of the work allows. 1910.176(c) Storage areas shall be kept free from accumulation of materials that constitute hazards from tripping, fire, explosion, or pest harborage. Vegetation control will be exercised when necessary. Cheerleading and basement storage rooms need to be cleaned and organized. REPEAT.

Please email your written response to safety@dopl.idaho.gov. Please include your Facility/Business No on the reply.

Office: 208-334-3233
E-mail: safety@dopl.idaho.gov

FACILITY REPORT

Facility / Business No: E-091-0002 / 6623

Inspector: RUSSELL SIDELL

Inspection Date: 02/14/2022

Owner: Idaho Falls School Dist #91
690 John Adams Parkway
Idaho Falls, ID 83401

Location:
Idaho Falls Sr High School
601 S HOLMES AVE
IDAHO FALLS, ID 83401

Contact: Kevin Klingler
Contact Phone: 2085257502
Contact E-mail: klinkevi@d91.k12.id.us

A response regarding your plans for corrective action for the potential safety hazards is required within 20 calendar days of receipt of report. Corrections need not be completed to respond. Should additional time be needed to formulate responses, an extension of time for up to 60 days may be requested. Include the Business number or State ID number with your response.

Recommendations:

(2/16/2022 6:05 AM RSI)

SAFETY ALERT

EACH YEAR HUNDREDS OF OUR FELLOW EMPLOYEES ARE INJURED ON THE JOB A LARGE PERCENTAGE OF THESE INJURIES WERE DUE TO SLIP AND FALLS THIS INCLUDES SNOW AND ICE, UNEVEN WALKING SURFACES (SIDEWALKS, FLOORS, STEPS), AND HOUSEKEEPING. WE NEED TO KEEP CORDS AND MATERIALS FROM BECOMING TRIP HAZARDS. LETS ALL HELP EACH OTHER GO HOME SAFE EVERY DAY.

1. 1910.37(a)(4) Safeguards designed to protect employees during an emergency (e.g., sprinkler systems, alarm systems, fire doors, exit lighting) must be in proper working order at all times.
(Trouble light on fire panel?).
2. 1910.36(g)(4) Objects that project into the exit route must not reduce the width of the exit route to less than the minimum width requirements for exit routes I.F.C. Table 1004.1 requires 20 sq. Ft. per person in E-occupancy. There are a number of very small classrooms in facility and large numbers of students. Need to monitor. MULTI YEAR REPEAT.
3. 1910.151(b) In the absence of an infirmary, clinic, or hospital in near proximity to the workplace which is used for the treatment of all injured employees, a person or persons shall be adequately trained to render first aid. Adequate first aid supplies shall be readily available. Basement custodial. (Out of date supplies) REPEAT.
4. 1910.305(g)(1)(iv)(B) Flexible electric cords are not allowed to be run through holes in walls, ceilings, or floors. Overhead projectors monitor. MULTI YEAR REPEAT.
5. 1910.303(g)(1)(i)(B) The width of working space in front of the electric equipment shall be the width of the equipment or 30 in., whichever is greater. In all cases, the working space shall permit at least a 90-degree opening of equipment doors or hinged panels. Basement riser room and Room # 221 panel (T).
6. 1910.37(a)(3) Exit routes must be free and unobstructed. No materials or equipment may be placed, either permanently or temporarily, within the exit route. [REDACTED]
7. 1910.305(g)(1)(iii) The flexible cord shall be equipped with an attachment plug and shall be energized from an approved receptacle outlet.
1910.334(a)(2)(i) Portable cord and plug connected equipment and flexible cord sets (extension cords) shall be visually inspected before use on any shift for external defects (such as loose parts, deformed and missing pins, or damage to outer jacket or insulation) and for evidence of possible internal damage (such as pinched or crushed outer jacket). piggy backingX5, exposed wires on desk type lamp, outlet sheathing exposed. Plant biology lab.
8. (Information) Slamming egress doors. South 7th street exit.

Please email your written response to safety@dopl.idaho.gov. Please include your Facility/Business No on the reply.

Office: 208-334-3233
E-mail: safety@dopl.idaho.gov

FACILITY REPORT

Facility / Business No: E-091-0002 / 6623

Inspector: RUSSELL SIDELL

Inspection Date: 02/14/2022

Owner: Idaho Falls School Dist #91
690 John Adams Parkway
Idaho Falls, ID 83401

Location:
Idaho Falls Sr High School
601 S HOLMES AVE
IDAHO FALLS, ID 83401

Contact: Kevin Klingler
Contact Phone: 2085257502
Contact E-mail: klinkevi@d91.k12.id.us

A response regarding your plans for corrective action for the potential safety hazards is required within 20 calendar days of receipt of report. Corrections need not be completed to respond. Should additional time be needed to formulate responses, an extension of time for up to 60 days may be requested. Include the Business number or State ID number with your response.

9. 1910.151(c) Where the eyes or body of any person may be exposed to injurious corrosive materials, suitable facilities for quick drenching or flushing of the eyes and body shall be provided within the work area for immediate emergency use.

ANSI Z358.1-Facilities for quick drenching or flushing shall meet the requirements of ANSI Standard Z358.1. and the first aid requirements of the chemicals or materials being used.: Eye wash spray heads and/or quick drench hose are missing protective cover & are not protected from airborne contaminants.

1910.151(c) Where the eyes or body of any person may be exposed to injurious corrosive materials, suitable facilities for quick drenching or flushing of the eyes and body shall be provided within the work area for immediate emergency use.

ANSI Z358.1-Facilities for quick drenching or flushing shall meet the requirements of ANSI Standard Z358.1. and the first aid requirements of the chemicals or materials being used.: Eye wash spray head(s) have residue: Activate eye wash at least weekly. The North East chemistry lab eye wash and shower are non-operational.

10. 1910.36(g)(2) An exit access must be at least 28 inches wide at all points. Where there is only one exit access leading to an exit or exit discharge, the width of the exit and exit discharge must be at least equal to the width of the exit access. 1910.22(d)(1) Walking-working surfaces are inspected, regularly and as necessary, and maintained in a safe condition. (Trip hazards). 1910.141(a)(3)(i) All places of employment shall be kept clean to the extent that the nature of the work allows.

1910.176(c) Storage areas shall be kept free from accumulation of materials that constitute hazards from tripping, fire, explosion, or pest harborage.

All basement storage areas, cheerleader storage. MULTI YEAR REPEAT. The storage rooms at facility are very unkept, trip hazards,

Please email your written response to safety@dopl.idaho.gov. Please include your Facility/Business No on the reply.

Office: 208-334-3233
E-mail: safety@dopl.idaho.gov

FACILITY REPORT

Facility / Business No: E-091-0002 / 6623

Inspector: JEFF HARRIS

Inspection Date: 04/19/2023

Owner: Idaho Falls School Dist #91
690 John Adams Parkway
Idaho Falls, ID 83401

Location:

Idaho Falls Sr High School
601 S HOLMES AVE
IDAHO FALLS, ID 83401

Contact: Kevin Klingler

Contact Phone: 2085257502

Contact E-mail: klinkevi@d91.k12.id.us

A response regarding your plans for corrective action for the potential safety hazards is required within 20 calendar days of receipt of report. Corrections need not be completed to respond. Should additional time be needed to formulate responses, an extension of time for up to 60 days may be requested. Include the Business number or State ID number with your response.

Recommendations:

(6/26/2023 8:12 AM JHA)

Due to timing DOPL inspector did not walk with Idaho Falls Fire Dept. in this facility this year.

Recommend referring the the Idaho Falls Fire Dept. Report from Chris Farnsworth Fire Inspector.